Background Levels of Metals in Soils for Cleanups

Background

To help improve assessment and eventual cleanup of metals-contaminated sites in Oregon, the Oregon Department of Environmental Quality Cleanup Program has prepared a data table specifying regional default background concentrations of various metals in Oregon soils.

DEQ compiled a statewide database for naturally occurring metals in soil and calculated summary statistics for 16 of these metals including lead, arsenic and mercury. It also calculated background metals concentrations, including the 95 percent upper prediction limit, using methods consistent with U.S. Environmental Protection Agency policy and guidance for 10 separate regions in Oregon (see Figure 1). These data and the statistical values derived from them will replace previous background metals concentrations in use by the DEQ Cleanup Program.

Why the new background data is important

DEQ analyzed and compiled the background metals data to:

- Better distinguish the sources of metals contamination on cleanup sites
- Reduce the burden of sampling and analytical costs for sites with metals contamination
- Refine and improve previous guidance on background metals concentrations
- Enable better comparisons of site data to background concentrations for naturally occurring contaminants

How DEQ gathered the data

DEQ compiled roughly 230,000 data points representing about 5,100 individual sampling locations statewide. For the 16 metals statistically analyzed, it calculated data minimums, maximums, means, percentiles, tolerance limits and prediction limits to characterize typical metals concentrations in soils within each individual region. The data came from a compilation of 10 individual databases from state (Department of Geology and Mineral Industries, DEQ), federal (U.S. Geological Survey, U.S. Department of Agriculture, Natural Resources Conservation Service), and academic (Portland State University) sources generated during geochemical, soil and mining exploration

investigations and several environmental cleanup sites. DEQ has posted a technical report summarizing the development of the background values at

http://www.deq.state.or.us/lq/pubs/docs/cu/DebO RbackgroundMetal.pdf

Updated values may now be used

These updated metals background values may now be applied on project-specific decision making for cleanup work in Oregon. The values in Table 1 of this fact sheet replace previous statewide background values contained in a 2002 DEQ memorandum subsequently incorporated into Appendix B of DEQ's Guidance for Assessing Bioaccumulative Chemicals of Concern in Sediment and into Table 1 of DEQ's Human Health Risk Assessment Guidance.

Applicability

DEQ has established background soil concentrations for 16 metals (antimony, arsenic, barium, beryllium, cadmium, chromium, copper, lead, manganese, mercury, nickel, selenium, silver, thallium, vanadium and zinc) in 10 regions across the state. These data can be used to:

- Determine whether the metals are present in site soil at concentrations exceeding estimates of background
- Identify whether or not these metals should be retained as chemicals of potential concern or chemicals of potential ecological concern in the DEQ cleanup process.

Use of regional default background concentrations

The regional default background concentrations for metals in soils presented in Table 1 represent the 95 percent upper prediction limit for 16 metals in 10 regions of Oregon. The numbers can be used by comparing the maximum detected concentration from a site database with the default background concentration for the appropriate region. If the maximum detected concentration is less than the default value, then that metal is not present in site soil above background levels and that metal is not a chemical of potential concern or potential ecological concern.



State of Oregon
Department of
Environmental
Quality

Land Quality Division Environmental Cleanup Program

811 SW 6th Avenue Portland, OR 97204 Phone: (503) 229-6258 (800) 452-4011 Fax: (503) 229-6954

Fax: (503) 229-6954 Contact: Annette Dietz www.oregon.gov/DEQ

Last Updated: 3/20/2013 By: Annette Dietz DEQ may develop additional guidance describing alternate methods to evaluate background samples such as statistical comparative screening techniques, hypothesis testing or application of geochemical evaluation techniques, in the future.

Alternate sources of background values

DEQ recognizes that at some sites it may be appropriate to use background values other than the regional default background metals concentrations. Any of the following options may be used to define natural background concentrations for metals at cleanup sites:

- 1) Site-specific background evaluations (i.e., a background evaluation done on un-impacted areas of similar soil type at or in the immediate vicinity of the subject site)
- 2) Site-specific background evaluations previously completed in the site's vicinity
- 3) DEQ regional default background concentrations

Transboundary soil transport

As shown in Figure 1 and Table 1, background levels for metals can vary from one region to the next. DEQ project managers need to carefully evaluate site-specific requirements when selecting a cleanup remedy including a "clean" soil cap by specifying background concentrations for the region where the facility is located in the Record of Decision.

DEQ Solid Waste makes determinations regarding soil that qualifies as "clean fill" for other circumstances. Contact Bill Mason, (541) 687-7427, for more information about the definition of clean fill.

Disclaimer

This document provides information and technical assistance to the public and DEQ employees about DEQ's Cleanup Program. This information should be interpreted and used in a manner fully consistent with the state's environmental cleanup laws and implementing rules. This document does not constitute rulemaking by the Oregon Environmental Quality Commission and may not be relied on to create a right or benefit, substantive or procedural, enforceable at law or in equity, by any person, including DEQ employees. DEQ may take action at variance with this guidance.

For more information

Contact Annette Dietz, DEQ Cleanup Program coordinator, Portland, 503-229-6258, or call toll-free in Oregon at 800-452-4011, ext. 6258.

Alternative formats

Alternative formats of this document can be made available. Contact DEQ's Office of Communications and Outreach, Portland, for more information at 503-229-5696, or call toll-free in Oregon at 800-452-4011, ext. 5696. People with hearing impediments may call 711.

ED_000719_00023990 EPA_001015

Background Levels of Metals in Soils for Cleanups

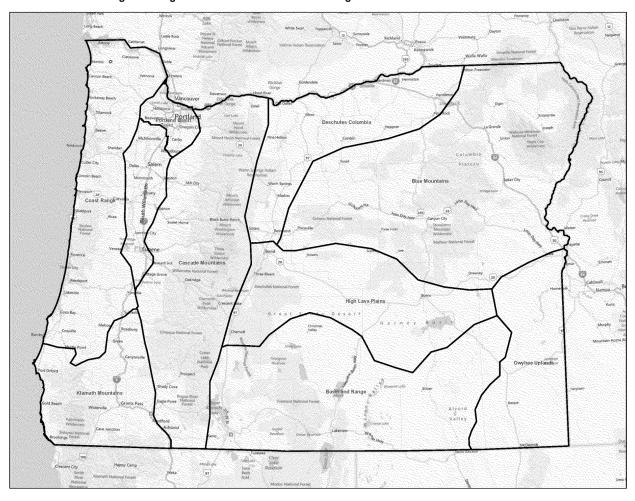


Figure 1. Regional Boundaries for Default Background Metals Concentrations in Soil

State of Oregon Department of Environmental Quality

3

ED_000719_00023990 EPA_001016

Background Levels of Metals in Soils for Cleanups

Table 1. Regional Default Background Concentrations for Metals in Soil State of Oregon

All concentrations in mg/kg

Metal	Basin and Range		Blue Mountains		Cascade Range		Coast Range		Deschutes - Columbia Plateau		High Lava Plains		Klamath Mountains		Owyhee Uplands		South Willamette Valley		Portland Basin	
Antimony	0.86	(a)	N/A	(c)	0.67	(a)	0.55	(a)	1.3	(a)	0.35	(a)	0.59	(a)	N/A	(d)	0.39	(a)	0.56	(b)
Arsenic	12	(a)	14	(a)	19	(a)	12	(b)	6.8	(b)	7.2	(a)	12	(a)	17	(a)	18	(b)	8.8	(b)
Barium	790	(b)	950	(b)	630	(b)	840	(b)	700	(b)	790	(b)	630	(b)	970	(b)	730	(b)	790	(b)
Beryllium	2.4	(a)	2.6	(a)	2.1	(a)	2.8	(a)	2.6	(a)	2.6	(a)	1.4	(a)	2.0	(b)	2.6	(a)	2.0	(b)
Cadmium	0.81	(a)	0.69	(a)	0.54	(a)	0.54	(a)	0.40	(a)	0.78	(a)	0.52	(a)	N/A	(c)	1.6	(a)	0.63	(a)
Chromium	100	(b)	190	(b)	200	(b)	240	(b)	170	(b)	140	(b)	890	(b)	120	(b)	100	(b)	76	(b)
Copper	110	(b)	120	(b)	73	(b)	100	(a)	29	(b)	62	(b)	110	(b)	50	(b)	140	(b)	34	(b)
Lead	29	(a)	21	(a)	34	(a)	34	(a)	18	(b)	21	(b)	36	(a)	30	(a)	28	(a)	79	(b)
Manganese	1600	(b)	1800	(b)	2100	(b)	2100	(b)	1300	(b)	1500	(b)	3000	(b)	1200	(b)	2900	(b)	1800	(b)
Mercury	0.28	(a)	1.4	(a)	0.24	(a)	0.11	(a)	0.040	(a)	0.060	(a)	0.17	(a)	0.75	(a)	0.070	(a)	0.23	(b)
Nickel	66	(b)	92	(b)	110	(a)	160	(b)	78	(b)	75	(b)	630	(b)	53	(b)	50	(b)	47	(b)
Selenium	0.41	(a)	0.93	(a)	0.52	(a)	1.5	(a)	0.46	(a)	0.54	(a)	0.80	(a)	0.49	(a)	0.68	(a)	0.71	(a)
Silver	0.42	(a)	0.51	(a)	0.17	(a)	0.41	(a)	0.82	(a)	0.68	(a)	0.16	(a)	2.2	(a)	0.33	(a)	0.82	(a)
Thallium	0.22	(a)	N/A	(c)	2.8	(a)	5.4	(a)	4.6	(a)	0.21	(a)	0.31	(a)	N/A	(d)	5.7	(a)	5.2	(a)
Vanadium	270	(b)	400	(b)	280	(b)	260	(b)	300	(b)	220	(b)	290	(b)	190	(b)	370	(b)	180	(b)
Zinc	130	(b)	160	(b)	170	(b)	140	(b)	130	(b)	140	(b)	140	(b)	120	(b)	200	(b)	180	(b)

Notes: Data generated with ProUCL, Version 4.1.00

N/A = Not available UPL = Upper prediction limit

(a) = 95% Kaplan-Meier UPL (t) (b) = 95% UPL

(c) = Not Enough Samples

(d) = No Data

State of Oregon Department of Environmental Quality

ED_000719_00023990 EPA_001017